


· Balancer inspection

CRANKSHAFT RUNOUT INSPECTION



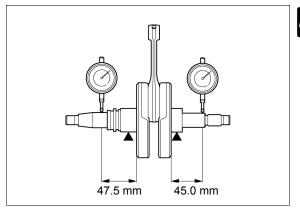

Set the crankshaft on V-blocks and measure the runout using a dial indicator.

Limit: 0.03 mm