


Drive Chain

4. Check the drive chain slider (2) at the intervals specified in the Maintenance Schedule.

The chain slider must be replaced if it is worn to the wear limit line (3). For replacement, see your Honda dealer.

LEFT SIDE

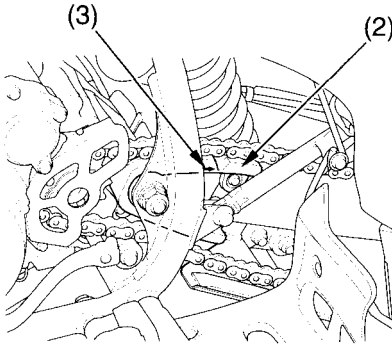


(2) drive chain slider

(3) wear limit line

5. With the upper or lower section of drive chain tight between the sprockets measure the distance between a span of 21 pins from pin centre to pin centre. If the distance exceeds the service limit, the chain is worn out and should be replaced.

Service limit:

319.1 mm (12.56 in)

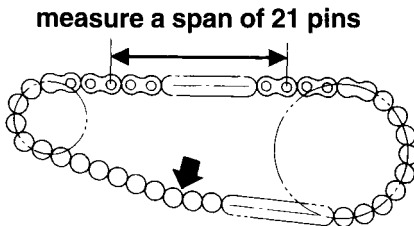

(cont'd)