

Replacement

With the upper or lower section of drive chain tight between the sprockets measure the distance between a span of pins from pin center to pin center. If the distance exceeds the service limit, the chain is worn out and should be replaced.

Service limit: 319.1 mm (12.56 in)

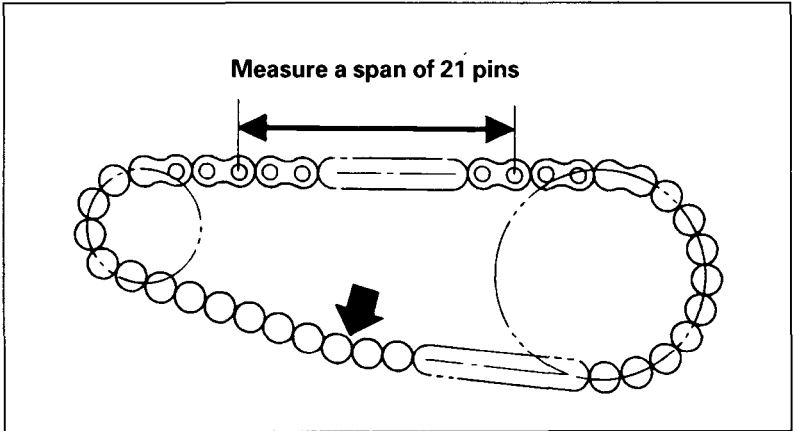


Fig. 4-14