

Drive Chain

4. Check the upper drive chain slider (2) and lower drive chain slider (3) for wear.


Measure the depth of the grooves in the upper drive chain slider and lower drive chain slider.

If the depth of the grooves in the each drive chain sliders reaches upper drive chain slider 10 mm (0.4 in)

lower drive chain slider 8 mm (0.3 in)

have your Honda dealer replace the drive chain sliders.

LEFT SIDE

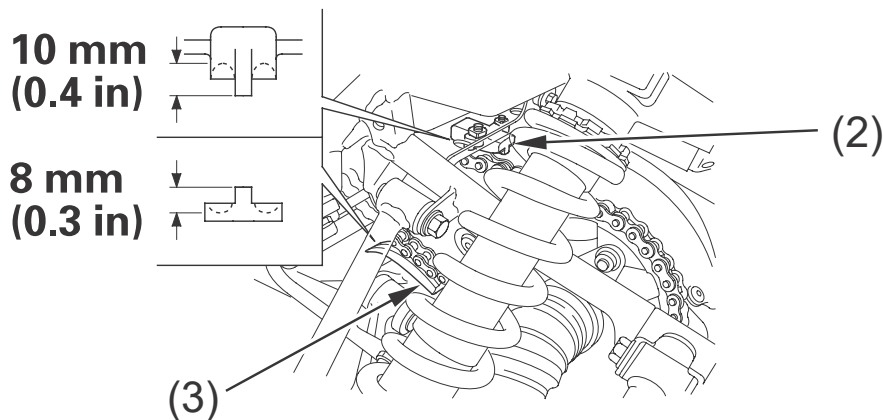


- (2) upper drive chain slider
(3) lower drive chain slider

5. With the upper or lower section of drive chain tight between the sprockets measure the distance between a span of 21 pins from pin centre to pin centre. If the distance exceeds the service limit, the chain is worn out and should be replaced.

Service limit:

319.1 mm (12.56 in)

measure a span of 21 pins

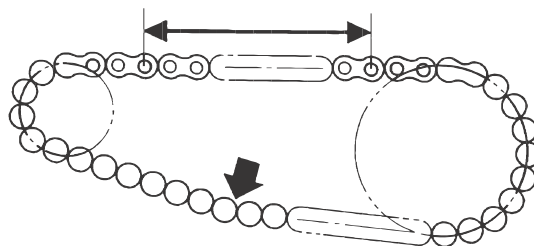

(cont'd)