
POOR PERFORMANCE AT HIGH SPEED

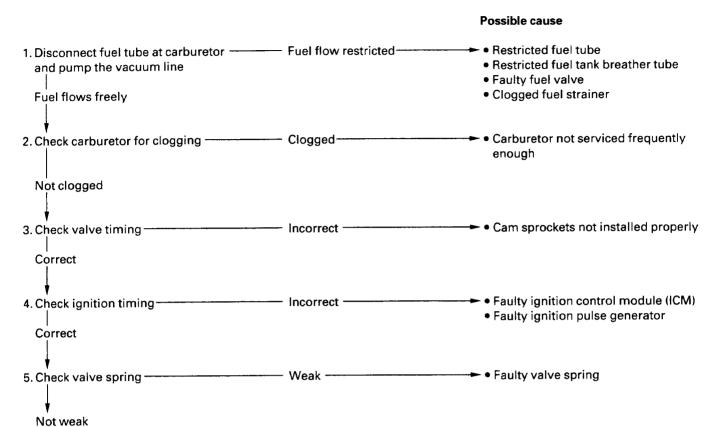

POOR HANDLING

Possible cause Steering stem adjustment nut too tight 1. If steering is heavy -• Damaged steering head bearings Excessive wheel bearing play 2. If either wheel is wobbling • Bent rim • Improperly installed wheel hub • Excessively worn swingarm pivot bearings • Bent frame Front and rear wheels not aligned 3. If motorcycle pulls to one side - Bent fork • Bent swingarm Bent axle • Bent frame